

December 3, 1991

TO ALL EXEC 90 BUILDERS
EXEC 90 ADVISORY BULLETIN A-03

In reference to the alternator mounting arm, part number E42-3130:

If you have already built this part according to drawing E31-2000 (prior to Revision 1, Dated 5-8-91) and construction manual section XII, photos 5-9 (prior to revision 1, Dated 9-91), disregard this bulletin.

If this part has not yet been built, the revised instructions should be followed, in which the plate E42-3120 is welded to the opposite side (outside) of the mounting arm. However, if this is done using the previous dimensions given (6-5/8" overall length), the mounting arm will be too short and will cause a belt clearance problem. Therefore, follow the drawing below, using your current parts, which will increase the overall length of the mounting arm and provide the necessary clearance.

If you purchased a quick kit, replace the original mounting arm weldment with the new one enclosed.

